

APC Easy UPS Online Monitoring Software v2.6-GA-01-23116 Release Notes

The APC Easy UPS Online Monitoring Software v2.5-GA-01-23116 release notes apply to the **APV9601 APC Easy UPS Online SNMP Card**, and the Easy UPS Online over serial and USB communications.

New Features

[Top ↑](#)

New Feature
OpenJDK Update The OpenJDK version bundled with the software is 17.0.4.

Fixed Issues

[Top ↑](#)

Fixed Issue
The software is now compatible with Windows 10, Windows 11, Windows Server 2016, Windows Server 2019, and Windows Server 2022.
Multiple vulnerabilities reported in the security notification published here & general security related improvements.
General security related improvements

Known Issues

[Top ↑](#)

Known Issue
You cannot use the special character “-“ in the SMTP ID and Email ID fields in the Email Configuration screen.
The Purchase Information screen does not display any data.
The Default button in the Parameter Settings screen does not work as expected.
The “Battery disconnected” event is not corrected logged in the Events Action screen and the Messages window. NOTE: This issue is only seen with SNMP.
SRV10KUXI, SRV15KUXI, and SRV20KUXI UPS devices do not enter bypass mode when the output power is off when Bypass when UPS is off is enabled in the Parameter Settings screen. Workaround: Power off the UPS device before enabling Bypass when UPS is off .
The Battery current for SRV10KUXI, SRV15KUXI, SRV20KUXI, 1KRIL, 2KUXI, and 3KRIL UPS devices is incorrectly displayed as 0.0 Amps in the Status Diagram screen.
After a successful self test, the “Battery self test passed” event is not logged to the Event Log. This issue affects SRV10KUXI, SRV15KUXI, and SRV20KUXI UPS devices.
Systray icon turns grey after several hours of communication, while the background UPS service continues to run and remains responsive.

Copyright © 2023 Schneider Electric. All rights reserved.

<https://www.apc.com>

990-6471C-001

06-2023