Pact Series

MasterPact MTZ - MicroLogic X Control Unit

Firmware Release Notes

Pact Series offers world-class breakers and switches

DOCA0144EN-15 02/2024





Legal Information

The information provided in this document contains general descriptions, technical characteristics and/or recommendations related to products/solutions.

This document is not intended as a substitute for a detailed study or operational and site-specific development or schematic plan. It is not to be used for determining suitability or reliability of the products/solutions for specific user applications. It is the duty of any such user to perform or have any professional expert of its choice (integrator, specifier or the like) perform the appropriate and comprehensive risk analysis, evaluation and testing of the products/solutions with respect to the relevant specific application or use thereof.

The Schneider Electric brand and any trademarks of Schneider Electric SE and its subsidiaries referred to in this document are the property of Schneider Electric SE or its subsidiaries. All other brands may be trademarks of their respective owner.

This document and its content are protected under applicable copyright laws and provided for informative use only. No part of this document may be reproduced or transmitted in any form or by any means (electronic, mechanical, photocopying, recording, or otherwise), for any purpose, without the prior written permission of Schneider Electric.

Schneider Electric does not grant any right or license for commercial use of the document or its content, except for a non-exclusive and personal license to consult it on an "as is" basis.

Schneider Electric reserves the right to make changes or updates with respect to or in the content of this document or the format thereof, at any time without notice.

To the extent permitted by applicable law, no responsibility or liability is assumed by Schneider Electric and its subsidiaries for any errors or omissions in the informational content of this document, as well as any non-intended use or misuse of the content thereof.

Table of Contents

Safety Information	5
About the Book	6
Firmware Release Notes	7
Introduction	7
Firmware Version 005.103.003	9
Firmware Version 004.109.000	9
Firmware Version 004.107.000	9
Firmware Version 004.105.003	10
Firmware Version 004.105.000	10
Firmware Version 004.101.000	10
Firmware Version 003.012.000	11
Firmware Version 003.011.000	11
Firmware Version 002.000.004	11
Firmware Version 002.000.003	11
Firmware Version 002.000.002	12
Firmware Version 001.000.206	13
Firmware Version 001.000.202	13
Firmware Version 001.000.200	13
Firmware Update	14
Updating Firmware of MicroLogic X Control Unit	14
Updating Firmware of Enerlin'X Devices	19
Purchasing and Installing a Digital Module	21

Safety Information

Important Information

Read these instructions carefully, and look at the equipment to become familiar with the device before trying to install, operate, service, or maintain it. The following special messages may appear throughout this documentation or on the equipment to warn of potential hazards or to call attention to information that clarifies or simplifies a procedure.



The addition of this symbol to a "Danger" or "Warning" safety label indicates that an electrical hazard exists which will result in personal injury if the instructions are not followed.



This is the safety alert symbol. It is used to alert you to potential personal injury hazards. Obey all safety messages that follow this symbol to avoid possible injury or death.

DANGER indicates a hazardous situation which, if not avoided, **will result in** death or serious injury.



WARNING indicates a hazardous situation which, if not avoided, **could result in** death or serious injury.

CAUTION indicates a hazardous situation which, if not avoided, **could result** in minor or moderate injury.

NOTICE

NOTICE is used to address practices not related to physical injury.

Please Note

Electrical equipment should be installed, operated, serviced, and maintained only by qualified personnel. No responsibility is assumed by Schneider Electric for any consequences arising out of the use of this material.

A qualified person is one who has skills and knowledge related to the construction and operation of electrical equipment and its installation, and has received safety training to recognize and avoid the hazards involved.

About the Book

Pact Series Master Range

Future-proof your installation with Schneider Electric's low-voltage and mediumvoltage Pact Series. Built on legendary Schneider Electric innovation, the Pact Series comprises world-class circuit breakers, switches, residual current devices and fuses, for all standard and specific applications. Experience robust performance with Pact Series within the EcoStruxure-ready switchgear, from 16 to 6300 A in low-voltage and up to 40.5 kV in medium-voltage.

Document Scope

This document provides you with the firmware version history of MicroLogic[™] X control unit. Use this document to determine whether an update to the latest version of the MicroLogic X firmware is interesting or relevant for your application.

This document also provides users with the technical information needed to update the firmware of MicroLogic X control unit, and download and install an optional Digital Module.

Validity Note

This document applies to MicroLogic X control units in MasterPact[™] MTZ circuit breakers.

NOTE: This document also applies to MicroLogic[™] Xi control units. A MicroLogic Xi control unit is a MicroLogic X control unit without Bluetooth[®] Low Energy communication.

Related Documents

The following table lists documents compatible with MicroLogic X control units with firmware version greater than or equal to 005.103.003.

Title of documentation	Publication date	Reference number
MasterPact MTZ - MicroLogic X Control Unit - User Guide	05/2023	DOCA0102EN-10

You can download these technical publications and other technical information from our website at www.se.com/ww/en/download.

Information on Non-Inclusive or Insensitive Terminology

As a responsible, inclusive company, Schneider Electric is constantly updating its communications and products that contain non-inclusive or insensitive terminology. However, despite these efforts, our content may still contain terms that are deemed inappropriate by some customers.

Trademarks

QR Code is a registered trademark of DENSO WAVE INCORPORATED in Japan and other countries.

Firmware Release Notes

Introduction

MicroLogic X Control Unit

MasterPact MTZ circuit breakers with MicroLogic X control units provide protection functions, metering, diagnostics, communication, and remote operations.

The control unit is customizable with optional Digital Modules.

MicroLogic X control units allow operation and monitoring of MasterPact MTZ circuit breakers locally or remotely.

NOTE: This release note also applies to MicroLogic Xi control units. A MicroLogic Xi control unit is a MicroLogic X control unit without Bluetooth[®] Low Energy communication. The firmware versions of the MicroLogic X and MicroLogic Xi control units are the same from firmware version 004.105.003.

MicroLogic X Firmware Release History

Date	MicroLogic X Firmware version	Availability
February 2024	005.103.003	Release for manufacturing
February 2023	005.103.003	Digital release in EcoStruxure Power Commission (EPC) software
October 2021	004.109.000	Obsolete
March 2021	004.107.000	Obsolete
October 2020	004.105.003	Obsolete
April 2020	004.105.000	Obsolete
December 2019	004.101.000	Obsolete
July 2019	003.012.000	Obsolete
March 2019	003.011.000	Obsolete
November 2018	002.000.004	Obsolete
April 2018	002.000.003	Obsolete
March 2018	002.000.002	Obsolete
December 2017	001.000.206	Obsolete
July 2017	001.000.202	Obsolete
December 2016	001.000.200	Obsolete

Firmware Update Policy

If the latest features of a firmware update are not required, it is not mandatory to update the firmware of a device.

Use this document to determine whether an update to the latest version of the MicroLogic X firmware is interesting or relevant for your application.

For more information about the firmware update policy and the firmware compatibility between devices, refer to DOCA0155EN *MicroLogic Trip Units and Control Units - Firmware History*.

Firmware Update with EcoStruxure Power Commission Software

EcoStruxure[™] Power Commission is the new name of Ecoreach software.

Use the latest version of EcoStruxure Power Commission software:

- · To check the firmware compatibility of the devices in the IMU
- · To update the devices with the latest firmware version available

After updating the firmware of one device, use EcoStruxure Power Commission software to check the firmware compatibility between IMU devices.

The Firmware Update table helps you to diagnose and identify all discrepancy issues between IMU devices. This table also provides the recommended actions for each discrepancy issue.

The latest version of EcoStruxure Power Commission software is available at: www.se.com.

For more information about the use of EcoStruxure Power Commission software, refer to *EcoStruxure Power Commission Online Help*.

Firmware Version 005.103.003

New Features

- Compatibility with the ANSI 51G IDMT ground-fault protection optional Digital Module.
- Digital Modules are available to purchase and install by contacting Schneider Electric Customer Care Centre or Schneider Electric Services.
 - **NOTE:** The Schneider Electric GoDigital marketplace is no longer available.

Bugs Fixed

- Firmware update process was stuck when MicroLogic X control unit was in non-nominal state.
- The event **Invalid Bluetooth communication** (0x1422) was generated spuriously.
- The MicroLogic X display screen was rebooting spuriously.

Firmware Version 004.109.000

Bugs Fixed

- Insignificant values displayed at load current close to 0 on MasterPact MTZ3 circuit breakers.
- The event **Replace Battery (0x1433)** was generated spuriously. Battery health detection improved.
- The event Last protection settings have not been applied (0x142F) was generated spuriously.

Firmware Version 004.107.000

New Features

- Performance improvement of self-test to monitor the presence of internal current power supply (CPS) sensors
 - **NOTE:** The discontinuity of internal current power supply (CPS) sensor can lead to user exposure to electric hazard. As a default behavior, a failed self-test can result in the opening of the circuit breaker to help to ensure user and material protection. In this case, the trip message **Replace Circuit Breaker Self Diagnostic (0x641F)** will be generated. For more information about this behavior, contact your Schneider Electric Customer Care Center and mention the following reference: FAQ000190726.
- Addition of automatic acknowledgment mode for orange pop-up messages related to medium severity protection alarms on the MicroLogic display screen

Bugs Fixed

- The event **Last protection settings have not been applied (0x142F)** was generated spuriously.
- The event Schedule manufacturer maintenance within three months (0x1482) was generated prematurely due to absence of commissioning date entered by the user in EcoStruxure Power Commission software.

Firmware Version 004.105.003

New Features

Addition of the MicroLogic Xi control units. A MicroLogic Xi control unit is a MicroLogic X control unit without Bluetooth Low Energy communication.

Firmware Version 004.105.000

New Features

Addition of self-test to monitor the presence of the internal current power supply (CPS) sensors

Firmware Version 004.101.000

New Features

- Compatibility with the following optional Digital Modules (available through the Schneider Electric GoDigital marketplace):
 - ANSI 51 IDMTL overcurrent protection
 - ANSI 67 Directional overcurrent protection
 - IEC 61850 for MasterPact MTZ
- · Compatibility with communication features:
 - RSTP (Rapid Scanning Tree Protocol)
 - NTP (Network Time Protocol)
- Addition of contact wear interpretation to facilitate the preventive maintenance of the circuit breaker
- · Firmware update process made faster and more reliable

Bugs Fixed

The following events were generated spuriously and simultaneously on display screen of MicroLogic X control unit:

- Control unit self test #2 (0x1470)
- Firmware Discrepancy within control unit (0x0D09)

Firmware Version 003.012.000

New Features

Compatibility with the ANSI 81 – Under/Overfrequency Protection optional Digital Module (available through the Schneider Electric GoDigital marketplace)

Firmware Version 003.011.000

New Features

- Addition of maintenance schedule reminder events to help user to plan preventive maintenance programs
- Password management: enhancement of user profiles from levels to role profiles
- Addition of ERMS force unlock command to unlock ERMS function if smartphone used to engage the function is unavailable

Bugs Fixed

- Possible loss of voltage release configuration
- The following events were generated spuriously:
 - Control unit self test #5 (0x1473)
 - Earth leakage (Vigi) sensor disconnected (0x1408)
 - Invalid Control Unit factory config #1 (0x0D0A)

Firmware Version 002.000.004

Bugs Fixed

- High consumption of battery in specific cases without auxiliary power supply
- The following alarms and pop-up messages were generated spuriously on display screen of MicroLogic X control unit:
 - Protection settings reset to factory value (0x1430)
 - Error 21 Service not performed Internal error
 - Error 190 Service not performed Internal error

Firmware Version 002.000.003

New Features

Conformity to UL/ANSI standard with the addition of the following control units:

- MicroLogic 3.0 X control unit (LV848815)
- MicroLogic 5.0 X control unit (LV847609)
- MicroLogic 6.0 X control unit (LV847608)

Firmware Version 002.000.002

New Features

- Compatibility with the following optional Digital Modules (available through the Schneider Electric GoDigital marketplace):
 - ANSI 27/59 Under/Over Voltage Protection Digital Module
 - ANSI 32P Reverse Active Power Digital Module
 - ANSI 51N/51G Ground-Fault Alarm Digital Module
- Individual Harmonics Analysis Digital Module
- Modbus Legacy Dataset Digital Module
- Energy Reduction Maintenance Settings (ERMS) Digital Module
- Addition of support for ERMS switch module (ESM)
- Protection setting procedure in 2 steps (Submit/Apply) for compliance with UL489SE
- Addition of current and power demand
- New calculation method for minimum and maximum values for current, voltage, and power factor
- · Addition of load profile monitoring
- Multiple events assignment with M2C or IO module
- Addition of long waveform capture in the Waveform Capture on Trip Event
 Digital Module
- Additional information with Configuration mismatch between IO and control unit event message
- Enhancement of reliability of event management and time-stamping
- · Addition of event code on event messages to improve diagnosis
- · Enhancement of internal battery test pattern
- · Enhancement of internal battery loss management
- Enhancement of external 24 Vdc power supply management
- Improved robustness of the file system management

Bugs Fixed

- Bluetooth LED remained on with Error 5 displayed, requiring control unit to be switched off and on
- Snapshot was not showing correct li coefficient pickup when Instantaneous protection was set to OFF
- Frequency measurement was shifted and/or unstable in 3-pole system using 3-wattmeter calculation
- Loss of event message Configuration mismatch between IO and control unit occurred when power cycling the control unit

Firmware Version 001.000.206

Bugs Fixed

- Incorrect calculation for In value:
 - · Value displayed was twice the expected value
 - Impacted only 3-pole MTZ3 circuit breakers with External Neutral Current Transformer (ENCT)
- Unexpected trip due to ground-fault protection test function occurred without pushing test button:
 - If the value of the current power supply (CPS) mode was decreasing at a specific rate while the voltage power supply (VPS) was being powered up simultaneously
 - Impacted only MicroLogic 6.0 X control units with VPS voltage power supply module

Firmware Version 001.000.202

Bugs Fixed

- Ground-fault test did not always operate with firmware that was directly flashed in MCU
- Service LED Orange HMI error 8/21/22 was displayed and no alarm/trip history

Firmware Version 001.000.200

Description

Initial firmware version

Firmware Update

Updating Firmware of MicroLogic X Control Unit

Prerequisites

The prerequisites for updating MicroLogic X firmware are the following:

- The latest version of EcoStruxure Power Commission software is downloaded and installed on the PC.
- The PC is connected to a power supply. Standby mode is deactivated to avoid the possibility of interruption during the update.
- The PC is connected to the mini USB port on the MicroLogic X control unit by using the USB cable with part number LV850067SP.
- The MicroLogic X control unit is continuously powered during the firmware update.
 - When the control unit is not connected to other ULP modules, it is powered by the PC through the mini USB port.
 - When the control unit is connected to other ULP modules, it is powered by an external 24 Vdc power supply.

For more information, refer to EcoStruxure Power Commission Online Help.

Procedure for Updating MicroLogic X Firmware

NOTICE

HAZARD OF INTERRUPTION OF POWER SUPPLY

- The MicroLogic X control unit must be continuously powered during the firmware update.
- Do not disconnect the USB cable before clicking the **CLOSE** button at the end of the update procedure with EcoStruxure Power Commission software.
- Do not perform a replacement of the MicroLogic X display screen during the firmware update.

Failure to follow these instructions can result in deterioration of the control unit.

During the firmware update, the standard protection functions of the MicroLogic X control unit are operational. No data or measurements are available or refreshed on the different communication interfaces.

Follow this procedure to update the firmware version of the MicroLogic X control unit:

Step	Action
1	Disable all wireless access (Bluetooth and NFC) between the MicroLogic X control unit and a smartphone.
2	Use the USB cable with part number LV850067SP to connect a PC to the mini USB port on the front face of the MicroLogic X control unit.

Step	Action									
3	Click Connect to device directly.									
	Create New Project Project Name	ළි 🗍								
	Launch Device Discovery	Communication Test Report								
		Updated 732 KB								
	Connect to device directly	 Communication Test Report Project Report 								
		Updated 742 KB								
	Launch Firmware Upgrade	Project Report								
4	Fill in the project details and click NEXT .									
	Codoware Power Commission Project details	- o x X								
	Projett Paras *									
	Project prepared By term									
	Company name									
	Company Lopo (p:g., prog or gif (upto 2046)	BROWSE								
	NEXT These details would be reflected in reports									
5	Fill in the end user site details and click CONTINUE									
	Project details	×								
	← END USER SITE DETAILS									
	Site Information Site Address Site nome Street									
	Market segment - City	Zip code								
	Sile contact name Country	• Side •								
	CONTINUE									

6								
	The MasterF	Pact MTZ	device is disp	played.				
	If a new MicroLogic X firmware version is available, a blue pop-up message is displaye							
	to invite the	user to up	date the firm	ware.				
	Click CONN	ЕСТ ТО Г	DEVICE.					
	EcoStruxure Power Commissi	on					-	
	Eco G truxure Power Comm	nission project	t11 TEST REPORTS	BATCH SETTINGS	8 < 6 8	С	ommunities 🛞 🔗	Schnei
	SWITCHBOARD VIEW		ON VIEW					
	Switchboard Grout Resolver	~	in a start	MyApplica				
	MyApplicationName			Application Type	: Distribution	Product range	: Masterpact MTZ	
				Rated current	: 6300A	Number of pol	es : 4-pole	
				IO 1 Date/Time	: Yes	Breaker A No	w Firmware version available Masternact MTZ ¹ Connect to	
				CONNECT TO	D DEVICE Connection	n: 🥑 Direct 🔿 I	e device and upgrade.	
			A a a f a					
			Setup protection, alarma Communication parame	is, IO's and aters of the	View device status, me device histories and lo	asurements, js	Firmware View the System firmware com status and upgrade if needed.	
			device					
							Connect	t to devic
			Digital Modules	onalities to the	Automatic trip te Perform test to ensure	sts hat the basic	Sone-Selective Interlock	ting Tes
			trip unit and activate it. Modules from Schneider website	Buy the Digital r Electric				
		Ð				ect via direct USB	Connect via c	direct U
7	Go to the Co	onfigure s	section and cl	lick Write	to Project t	o save the N	/licroLogic X	
	Settings.							
8	Click Firmw	are.						
	Firmware Upgrade	we address	Medule	Status	Davice Version	Ausitable Version	0 recommended action(s) REFR	ESH
	COM	248	Masterpact MTZ	€ Status	002.000.004	003.011.000	Contraction Acade	ר
	CONH		C RESTART MODULE					
	- CONT						None	
	- CONT		i0 1	C	003.003.011	003.004.005	None	
			5 101	C C	003.003.011	003.004.005	None	
			io 1	C C	003.003.011 003.007.024 V003.007.024	003.004.005 003.009.010 V003.009.010	None	
			io 1	C C	003.003.011 003.007.024 V003.007.024	003.004.005 003.009.010 V003.009.010	None	
			្រី 101 ថ្មី 172	C C	003.003.011 003.007.024 V003.007.024	003.004.005 003.008.010 V003.009.010	None Currently UPGRADE None Currently UPGRADE None	
10		Power C		© ©	003.003.011 003.007.024 V003.007.024	003.004.005	Nore Surgerung Nore Nore Read the	
10	EcoStruxure message an	Power C d click I U	ommission so	oftware d ₽ to cont	003.003.011 003.007.024 V003.007.024 isplays a saf	003.004.005 003.009.010 V003.009.010 v003.009.010	Nore Contraction Nore Nore Nore	
10	EcoStruxure message an	Power C d click I U	ommission se	oftware d D to cont	003.003.011 003.007.024 V003.007.024 isplays a saf	003.004.005 003.008.010 V003.008.010 ety messag	Nore Construction Nore Nore Read the	
10	EcoStruxure message an Fromwere Opgrade	Power C d click I U	ommission se	oftware d D to cont	003.003.011 003.007.024 V003.007.024 isplays a saf	003.004.005 003.000.000 vv03.008.010 ety messag	Nore Control of the second se	ESH
10	EcoStruxure message an Firmware Upgrade Connection Med	Power C d click I U	ommission se NDERSTAN	© oftware d D to cont	003.003.011 003.007.024 V003.007.024 isplays a saf inue.	collosado collosado vollosado vollosado ety messag	Nore Compared and the Recommended and the Recommended and the	C ESH'
10	EcoStruxure message an Connection Mod COM4	Power C d click I U	in 1 in E in E in E in DERSTAN Module Module Module RESTART MODEL	oftware d D to cont	003.003.011 003.007.024 v003.007.024 isplays a saf inue. Device Version 002.000.003	003.004.005 003.000.010 V003.000.010 ety message Ausliable Version 002.003.004	Nore Processes Processes P	ESH ion
10	EcoStruxure message an Firmware Upgrade Connection Med	Power C d click I U bus address 245	Module	oftware d D to cont	003.003.011 003.007.024 V003007.024 isplays a saf inue. Device Version 002.000.003 003.003.011	003.004.005	Nore Control of Action (C) PERPARE Nore Recommended Action (C) PERP Recommended Action (C) PERP Recommended Action (C) PERP Recommended Action (C) PERP Recommended Action (C) PERPARE Nore	- SSH ion
10	EcoStruxure message an Firmware Upgrade Connection Med COM4	Power C d click I U	ommission so NDERSTAN	© oftware d D to cont	003.003.011 003.007.024 V003.007.024 isplays a saf inue. Device Version 002.000.003 003.003.011	003.004.005	Nore Prove	E SH ion
10	EcoStruxure message an Connection Mod Connection Mod	Power C d click I U	ID 1	Continue of the second of the	003.003.011 003.007.024 v003.007.024 isplays a saf inue. Device Version 002.000.003 003.003.011 DTICE T DAMAGE	003.004.005 003.000.010 ety message Austable Version 002.000.004 003.004.005 003.004.005	Nore Nore Processed the Processed of as tary(a) Reconsended Act Constraints Processed of as tary(a) Reconsended Act Constraints Processed Processed	E SQH
10	EcoStruxure message an Frontware Upgrade Connection Med	Power C d click I U	Module	Continuents of the second seco	003.003.011 003.007.024 v003.007.024 isplays a saf inue. Device Version 002.000.003 003.003.011 TDAMAGE rupped devices is not simmare upgrade.	003.004.005	Nore Very Control of Active(a) REPR Recommended Act Control of Active(a) REPR Recommended Active(a) RE	E SSIN
10	EcoStruxure message an Firmware Upgrade Connection Med	Power C d click I U	ID 1 ID 1 IFE IFE ID 1 IFE	Contract of the power of the po	003.003.011 003.007.024 0003.007.024 iisplays a saf inue. Device Version 002.003.003 0	003.004.005 C02.0090.00 C02.000.004 C02.000 C0	Nore	ion
10	EcoStruxure message an	Power C d click I U	ID 1 ITE ITE ID	Control of tware d D to cont Status Control of the control Canto of EQUIPMEN Ensure that the power Interrupted during the control Canto of EQUIPMEN Ensure that the power Interrupted during the control Canto of EQUIPMEN Ensure that the power Interrupted during the control Canto of EQUIPMEN	003.003.011 003.007.024 003.007.024 isplays a saf inue. Device Version 002.000.003 003.003.011 002.000.003 003.003.011 0070CE r aupply of the device is not firmware upgrade. icclow with the device is not firmware upgrade. istructions can result in	003.004.005 002.000.004 002.000 002.00	Nore Nore Nore Nore Recard the Recommended Act Nore Recommended Act Nore Nore Nore Nore Nore Nore Nore	contraction of the second seco
10	EcoStruxure message an	Power C d click I U	ID 1	Contract of the set of	003.003.011 003.007.024 003.007.024 isplays a saf inue. Device Version 002.000.003 003.003.011 007.00E r sprover upgrade. structions can result in NACEL INDERSIDATION	003.004.005 003.000.010 ety message Austable Version 002.000.004 003.000.010 003.000.010	Nore Superstanding Nore Participation Nore Recommended Act Society (n) REF Recommended Act Nore Recommended Act Recommended Recommended Recommended Recommended Recommended Recommended Recommended Recommended Rec	c Still
10	EcoStruxure message an Firmware Upgrade Connection Med	Power C d click I U	Module Module	Contract of the series of the	003.003.011 003.007.024 V03007.024 isplays a safe inue. Device Version 002.000.003 003.003.011 TORCE T DAMAGE T DAMAGE T Supply of the device is not infirmere upgrade. Lefon with the device is not infirmere upgrade.	003.004.005 003.000.010 ety message 002.000.014 002.000.014 003.000.015 003.000.015 003.000.015 003.000.015	Nore Prove Prove Proceeding Prove P	
10	EcoStruxure message an	Power C d click I U	Medule	Control of tware do Do to control of tware do Do to control of tware do Do to control of tware do to control of tw	003.003.011 003.007.024 0003.007.024 isplays a saf inue. Device Version 002.003.011 002.003.011 007.02E T supply of hedvice is not sfmmars upgrade. structions can result in NACEL UNDERSTAND	003.004.005 C01.0590.010 C01.0590.010 C01.0590.010 C01.0590.010 C01.0590.010 C02.000.004 C02.000 C02.004 C02.000 C02.004 C02.0	Nore Nore Proceedings Procee	ion in
10	EcoStruxure message an	Power C d click I U	ID 1 ITE ITE ID	Control of tware d D to cont Status Control of the control Control of the control of the control of the control Control of the control o	003.003.011 003.007.024 V003.007.024 isplays a saf inue. Device Version 002.000.003 003.003.011 DEVICE r upply of the device is not firmware upgrade. terructions can result in NNCEL INDERSTAND	003.004.005 002.000.004.005 002.000.004.005 002.000.004 002.000 002.00	Nore Nore Proceedings Procee	E SH

Step	Action									
11	EcoStruxure Power Administrator pass	r Commissi word and cl	on software lick CONTIN	asks you to c UE .	onfirm the upo	date. Enter the				
	EcoStruxure Power Commission					- 0				
	Firmware Upgrade	Mortule	Status	Device Version	0 rec	Recommended Action				
	COM4 248		act MTZ C	002.000.003	002.000.004	Constituent Action				
		io 1	C	003.003.011	003.004.005	C UPORADE None				
		i ife	Do you confirm operation?	to perform this	003.009.010 V003.009.010	C UPGRADE None				
			Please enter the par	sword *						
				CANCEL CONTINUE						
						CLOSE				
12	EcoStruxure Powe	Commissi	on software	displays the f						
12	update:	Commissi	on sollware	uispiays the h	bilowing mess	age during an				
	Firmware L	Firmware Upgrade - Masterpact MTZ								
	Step 1/3	Step 1/3								
	Preparing for firmware upgrade									
	About 10 minutes remaining									
	Do not disconnect the device till the firmware upgrade is complete.									
	The update takes a	pproximate	ely 10 minute	S.						
	NOTE: Do not connect a smartphone to the MicroLogic X control unit during the firmware update.									
	NOTE: During the firmware update, the standard protection functions of the MicroLogic X control unit are operational. No data or measurements are available or refreshed on the different communication interfaces.									
	The MicroLogic X c	ontrol unit :	screen displa	ays the follow	ing message	during an update:				
	Schneider									
	Please wait while updating									
13	When the update is message indicating acknowledge.	finished, E that the de	EcoStruxure evice has be	Power Comm en successful	ission softwa ly updated. C	re displays a lick CLOSE to				

Step	Action								
14	Result: EcoStruxure Power Commission software indicates other Enerlin'X devices which need to be updated, if any. If the page does not refresh automatically, click REFRESH .								
	EcoStruxure Power	Commission					- 🗆 X		
	Firmware Up	ograde					mmended action(s) REFRESH ?		
	Connection	Modbus address	Module	Status	Device Version	Available Version	Recommended Action		
	COM4	248	Masterpact MTZ C RESTART MODULE	ø	003.011.000	003.011.000	None		
			IO 1	C	003.003.011	003.004.005	OUPGRADE		
			🖆 IFE	0	003.005.003	003.009.010 V003.009.010	UPGRADE Upgrade firmware		
	 The status indicates whether the firmware of other modules is compatible with the firmware version of the MicroLogic control unit: Green: compatible, update is not mandatory Red: firmware not compatible, update firmware or upgrade the module to a later version 								
15	Update the Firmware	he firmware e of Enerlin'	version of assoc X Devices, page	iated I 19).	Enerlin'X de	vices, if any (s	ee Updating		

NOTE: When updating aMicroLogic X control unit with firmware version 001.000.200 to the latest version of the firmware, red pop-up trip or alarm messages may be displayed on the MicroLogic X display screen following the firmware update. This corresponds to trip or alarm messages that were not acknowledged by the user before the firmware update. Press the **ESC** button on the control unit to remove these messages.

Updating Firmware of Enerlin'X Devices

Introduction

After updating the firmware of an Enerlin'X device connected to the MicroLogic X control unit, use the latest version of EcoStruxure Power Commission software to check the firmware compatibility between IMU devices.

The Firmware Update table helps you to diagnose and identify all discrepancy issues between IMU devices. This table also provides the recommended actions for each discrepancy issue.

The firmware update of the Enerlin'X devices with EcoStruxure Power Commission software can be done:

- With the PC connected to the communication network.
- With the PC connected to the mini USB port of the MicroLogic X control unit for MicroLogic X control units with firmware version greater than or equal to 002.000.000, EIFE/IFE interface with firmware version greater than or equal to 003.007.024, and IO module version greater than or equal to 003.003.016.

NOTE: If Enerlin'X devices are associated with the MicroLogic X control unit, from the start of the MicroLogic X firmware update and until the Enerlin'X devices are updated, the event **Critical firmware modules discrepancy** is detected. An event message is displayed on the screen of the control unit.



When there is a firmware discrepancy between the MicroLogic X control unit and the communication interfaces (IFE, EIFE, or IFM interface), MicroLogic X data is not available remotely.

Procedure for Updating Enerlin'X Device Firmware



HAZARD OF INTERRUPTION OF POWER SUPPLY

The Enerlin'X device must be continuously powered during the firmware update.

Failure to follow these instructions can result in equipment damage.

Follow this procedure to update the firmware version of an Enerlin'X device, for example, EIFE interface, with the PC running EcoStruxure Power Commission software and connected to the mini USB port on the MicroLogic X control unit, by using the USB cable with part number LV850067SP.

	After updating the firmware of the MicroLogic X control unit, the EcoStruxure Power Commission page refreshes automatically. If it does not refresh, click REFRESH .							
	Result: I updated.	EcoStruxure	Power Commiss	ion sof	ftware indica	tes the next Er	nerlin'X device	
	EcoStruxure Power	r Commission					- 0	
	Connection	Modbus address	Module	Status	Device Version	0 reco Available Version	mmended action(s) REFRESH Recommended Action	
	COM4	248	Mesterpact MTZ	C	003.011.000	003.011.000	None	
			10 1	¢	003.003.011	003.004.005	C UPGRADE	
			ife ife	8	003.005.003	003.009.010	😨 UPGRADE	
			-			V003.009.010	Upgrade firmware	
	Click UP to be upo firmware NOTE: D interface	GRADE . Th dated. The N update. During the fir	e update takes be licroLogic X Adm mware update, no	etweer inistrat	10 and 25 r for password is available o	ninutes, deper l is required to on the Etherne	upgrade firmware	
	Click UP to be upo firmware NOTE: D interface	GRADE . Th dated. The M update. During the fir the EcoStru:	e update takes be licroLogic X Adm mware update, no xure Power Comr	etweer inistrat o data nissior	10 and 25 r for password is available o	ninutes, deper l is required to on the Etherne	Upgrade firmware adding on the dee launch the t communicatio	
	Click UP to be upo firmware NOTE: D interface Refresh t Result: f need to b	GRADE. The Mupdate. During the fir the EcoStru: EcoStruxure be updated,	e update takes be licroLogic X Adm mware update, no xure Power Comr Power Commiss if any.	etweer inistrat o data nissior ion sof	n 10 and 25 r tor password is available o n page. ftware indica	ninutes, deper l is required to on the Etherne tes other Ener	Upgrade firmware ading on the der launch the t communication	

Purchasing and Installing a Digital Module

Prerequisites

The prerequisites to purchasing and downloading a Digital Module are as follows:

• The firmware version of the MicroLogic X control unit must be compatible with the Digital Module (refer to table below). Update the firmware version of the MicroLogic X control unit if the Digital Module required is not compatible.

Digital Module	Commercial reference	Minimum MicroLogic X firmware version
ANSI 51G - IDMT ground-fault protection	LV850038	005.103.003
IEC 61850 for MasterPact MTZ	LV850046	004.101.000
ANSI 67 - Directional short-time overcurrent protection	LV850015	004.101.000
ANSI 51 - IDMTL overcurrent protection	LV850037	004.101.000
ANSI 81 - Under/Over frequency protection	LV850013	003.012.000
Individual harmonics analysis	LV850006	002.000.002
ANSI 27/59 - Under/Over voltage protection	LV850012	002.000.002
ANSI 32P - Reverse active power protection	LV850011	002.000.002
ANSI 51N/51G - Ground-fault alarm	LV850007	002.000.002
Energy Reduction Maintenance Settings (ERMS)	LV850009	002.000.002
Modbus legacy dataset	LV850045	002.000.002
Energy per phase	LV850002	001.000.002
Power restoration assistant	LV850004	001.000.002
MasterPact operation assistant	LV850005	001.000.002
Waveform capture on trip event	LV850003	001.000.002

- The latest version of EcoStruxure Power Commission software is downloaded and installed on the PC.
- The PC is connected to a power supply.
- The PC is connected to the Internet.
- You have the identification number of the MicroLogic X control unit.
- You have the commercial reference of the Digital Module to be purchased.
- You provide the email address to receive the Installer email containing Digital Module download information.

Getting Control Unit Identification Number

You can get the control unit identification number on site or off site using one of the following means:

- On site, by scanning the QR code on the front face of the MicroLogic X control unit from a smartphone. The QR code identifies the MicroLogic X control unit. Use the **Share** button to share the control unit information with the person qualified to select and purchase Digital Modules.
- On site, from EcoStruxure Power Commission software with a PC connected to the mini USB port of the MicroLogic X control unit.

 Off site, from EcoStruxure Power Commission software. This access can only be used for a MicroLogic X control unit previously registered in the relevant project.

Purchasing and Downloading a Digital Module

Follow this procedure to purchase and download a Digital Module:

Step	Action
1	Contact your local Schneider Electric Customer Care Center (CCC) or Schneider Electric Services Representative.
	Visit the www.se.com website to contact your local Schneider Electric CCC.
2	Provide the information indicated in <i>Prerequisites</i> and purchase the Digital Module.
	You will receive an Installer email at the address you indicated to CCC.
3	Select the email from <i>dsc-no-reply@verified.se.com</i> to download your Digital Module. The subject is Your Digital Modules are ready for download . Your Digital Module appears in a list of items ready to be downloaded.
	NOTE: If you do not see the email in your Inbox, check the Junk mailbox.
4	Click the checkbox next to the Digital Module that you want to download and click Download to download the delivery package.
	Schneider GElectric
	Your Digital Module(s) associated to the S/N 00003N1645210224 of the Micrologic control unit LV847602 are ready to be downloaded
	Digital Modules Select All
	00003N1645210224LV847602_DM_LV850009_V001.000.000.07.sc
	Download
	NOTE: This delivery package is used to install the Digital Module on the MicroLogic X control unit using EcoStruxure Power Commission software. Make sure that the delivery package is present on the PC used to install a Digital Module.
	NOTE: If the Digital Module was purchased previously, you can access the file downloaded by clicking the following link: https://digitalpackage.schneider-electric.com/dpb?lang=en.

Installing a Digital Module on the MicroLogic X Control Unit

The MicroLogic X Administrator, Services, or Engineer password is required to install a Digital Module on the MicroLogic X control unit.

Follow this procedure to install a purchased Digital Module on a MicroLogic X control unit.

Step	Action
1	Use the USB cable with part number LV850067SP to connect a PC running EcoStruxure Power Commission software to the mini USB port on the front face of the MicroLogic X control unit.
2	Click Connect to device directly to establish a connection between the EcoStruxure Power Commission software and the MicroLogic X control unit. EcoStruxure Power Commission software displays the MicroLogic X control unit identification number on the screen.
3	Open the Digital Module page by clicking Digital Modules .
4	Check that the delivery package for the Digital Module to be installed is present on the PC being used.
5	Select the Digital Module to be installed by clicking Install.
	The standard protection functions of the MicroLogic X control unit remain active during installation of the Digital Module.

Step	Action
	NOTE: Only modules previously purchased can be installed directly by clicking Install.
6	EcoStruxure Power Commission software asks you to confirm the installation. Enter the Administrator password and click CONTINUE .
7	A message is displayed to indicate that the Digital Module is being installed. Click the cross to continue.
	Super-blocked Control conduction of Vice Pressors Breachboard IFE-E38004 Breachboard Image: Strain Stra
8	When installation is complete and before unplugging the PC, disconnect EcoStruxure Power Commission software from the MicroLogic X control unit by clicking the Disconnect button.
9	Use the EcoStruxure Power Device app to check that the Digital Module is installed.
10	Use the EcoStruxure Power Device app or EcoStruxure Power Commission software to check that the Digital Module is working correctly.

For more information, refer to EcoStruxure Power Commission Online Help.

NOTE: To uninstall a Digital Module, use EcoStruxure Power Commission software.

Schneider Electric 35 rue Joseph Monier 92500 Rueil Malmaison France

+ 33 (0) 1 41 29 70 00

www.se.com

As standards, specifications, and design change from time to time, please ask for confirmation of the information given in this publication.

© 2024 - Schneider Electric. All rights reserved.

DOCA0144EN-15