

Release 2.25 overview

1. Release files stored in Artifactory

- FW package for DFU tool
 - [SpaceLogic KNX DFU 00 22.zip](#)
 - [SpaceLogic KNX DFU 00 22.SELF.cms](#)
- FW for Master device
 - [OM08RLYR B 12 06 00](#) (with bootloader V 2.3)
- FW for Extension device
 - [OE08RLYR B 12 06 01](#) (with bootloader V 2.4)

2. ETS

- Supported same ETS application as for previous officiation release available in web and KNX catalogue
 - [MTN6705-0008 5800/1.0 Software ETS5 \(knxprod\) \(Version V1.0\)](#)

3. Important links

- FW matrix in Confluence [FW MATRIX accros the devices](#)

New functionalities review

HMI in wiring test update requested by customers:

LO-3443 HMI - WIRING test - improvement of the functionality

in low priority mode:

- possibility to switch ON every second channel (one of the pairs) per device
- 1or2; 3or4; 5or6; 7or8

in high priority mode (long press of hand control when hand LED blinking)

- 1or2; 3or4; 5or6; 7or8

Faster switching of the channels based on the current output state after Safety signal

LO-3778 Switch driver update for Safety signal Implementation

LO-3548 Switch driver update for Safety signal I

LO-3894 NCV driver update (version 2.0)

Removed PIN “1234” from forbidden pin codes list:

LO-3877 Remove PIN 1234 from the forbidden PINs list

Blind stops driving when the Lock-Objects gets active

LO-3459 Blind stops driving when the Lock-Objects gets active

Bugs fixes



JIRA ID	Description	Severity	Status
<u>LO-3940</u>	Error when FW change from 12.4.0 to 12.0.0	Critical*	Released
<u>LO-3932</u>	FW SpaceLogic_KNX_DFU 00_14.zip update do NOT finish	Critical*	Released
<u>LO-3947</u>	Read Bootloader version do NOT fit to number in Matrix	Major*	Released
<u>LO-2957</u>	DFU tool - not able to read diagnostic from Extensions, when KNX disconnected	Major*	Released
<u>LO-3015</u>	ADC channel option enable-disable	Major*	Released
<u>LO-3881</u>	During dimming up in staircase send stop staircase and the feedback off was not send	Average*	Released
<u>LO-3889</u>	Shutter/Blind: When Used extended time the feedback of moving is sent twice and late	Average*	Released

Bugs fixes



JIRA ID	Description	Severity	Status
<u>LO-3880</u>	Shutter and blind Movement above the limit after ALARM	Average*	Released
<u>LO-3323</u>	Shutter and blind Movement Up/Dn status UPDATE (DPT update)	Average*	Released
<u>LO-2919</u>	Blind: Active / deactivate high priority function during movement.	Minor*	Released
<u>LO-3430</u>	Blind: Scene is not temporary disable the automatic mode	Minor*	Released

Known Bugs



JIRA ID	Description	Severity	Status
<u>LO-3876</u>	Partial download - Extensions COMMISSIONING failure when are disabled in ETS => KNX org #178919	Average*	
<u>LO-3870</u>	ETS - application freezing after DimmerM/DimmerE/DimmerE => KNX org #179067	Average*	
<u>LO-3931</u>	PIN: The message about PIN is not true "No valid PIN Code for Firmware Uptate!"	Minor*	
<u>LO-3959</u>	Blind: Slat Feedback is not sent with use Blind Type 2 and 4 and use operation position	Minor*	

Life Is On



Schneider
Electric