



This product is a conversion kit for installing XBT GT5330 in place of XBT G5330. By using this product you can replace the current model with a new model that has smaller panel cutout dimensions.

Package Contents

This unit has been carefully packed, with special attention to quality. However, if for any reason you find any of the contents of this package damaged or missing, please contact your local Schneider-Electric local distributor.

Before installing XBT GT unit with Panel Cut Out Adapter, check that you have all items listed below:

Packing list		
Panel Cut Out Adapter x 1		
Gasket x 1		
M4 Hex nut x 8		
Exclusive installation fastener x 4		

Prerequirements

Before installing the XBT GT unit with Panel Cut Out Adapter, ensure that your installation can support the following characteristics:

Item	XBT GT5330 Specified Values	
Protective Construction	Protection: Equivalent to IP65 (Front face of installed unit)	
Weight	0.45 kg (0.99lb.) or less (Panel Cut Out Adapter only)	
External Dimensions	W: 317 mm (12.48 inch) H: 243 mm (9.57 inch)	
Color	Silver metallic	
Material	Steel plate	























Installing the XBT GT5330 unit:

For numbers in brackets, refer to illustration below.

Step	Action	
1	Check that the XBT GT5330 unit (1), and the moisture resistant gasket (2) are present.	
2	Make sure the moisture resistant gasket is fitted properly onto the XBT GT5330 unit.	
3	Install the gasket (4) to the Panel Cut Out adapter (3) correctly.	
4	Insert the attachment prepared in Step 3 into the cutout section of the XBTG5330 operation panel of the target model by matching the threaded part of the plate with the four corners of the panel.	
5	Confirm the gasket is installed correctly.	
6	Tighten the M4 hex nuts (6) evenly to 0.5N.m (4.4lb-in.).	
7	Attach the XBT GT5330 unit (1) to the Panel Cut Out Adapter by using the installation fasteners (5).	
8	Tighten the fastener attachment screws to 0.5N.m (4.4lb-in.).	

A CAUTION

EQUIPMENT DAMAGE HAZARD

Do not exert more than 0.5Nm (4.4in-lb) of torque when tightening the fastener screws and hex nuts.

Failure to follow this instruction can result in injury or equipment damage.




















Ilustration of XBT GT5330 installation.

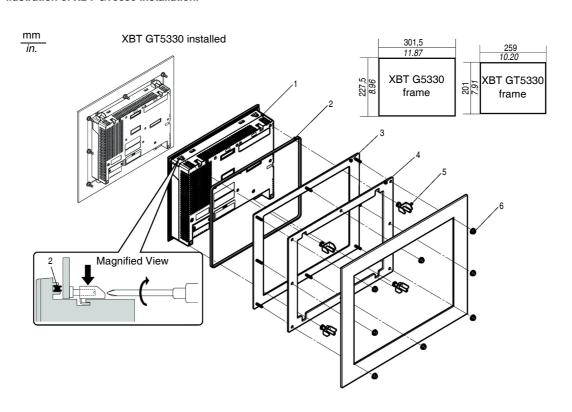

Main unit and accessories in illustration.

Main unit and accessories	Item
XBT GT5330 unit x 1	(1)
Moisture resistant gasket x 1	(2)
Panel Cut Out Adapter x 1	(3)
Gasket x 1	(4)
Exclusive installation fastener x 4	(5)
M4 Hex nut x 8	(6)













